

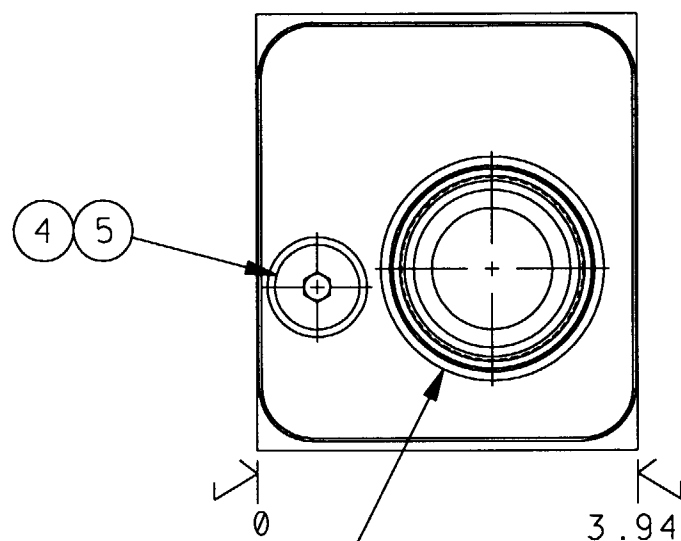
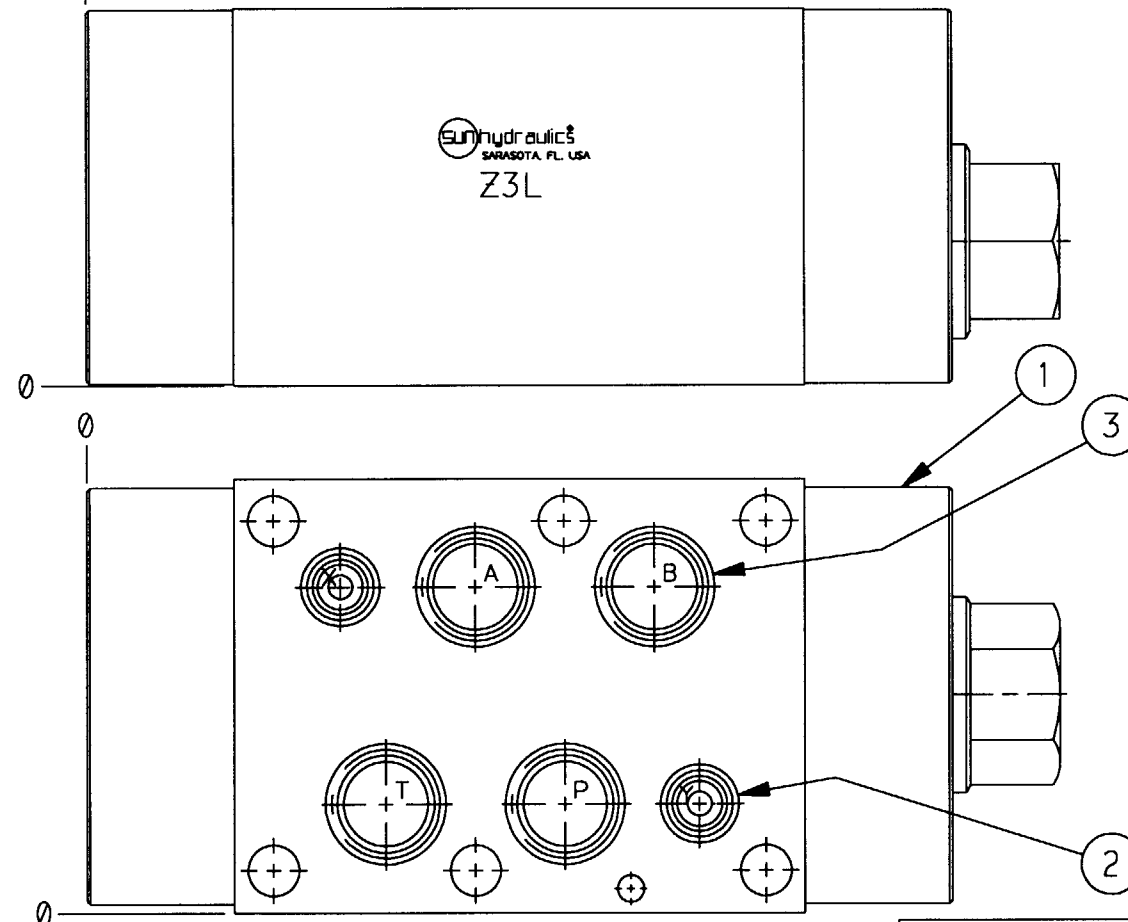


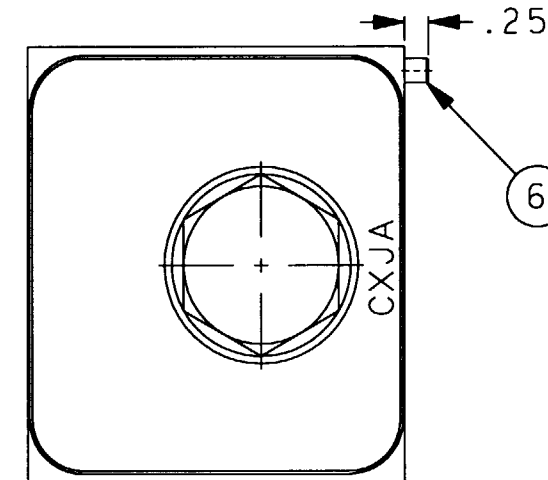

T-19A CAVITY
1.156 L.S. DEPTH


NOTES :

- 1) SEALS : BUNA-N
- 2) CXJA XCN CARTRIDGE :
CRACKING PRESSURE : 30 PSI $\pm$ 3
CHECK SEAT : STEEL

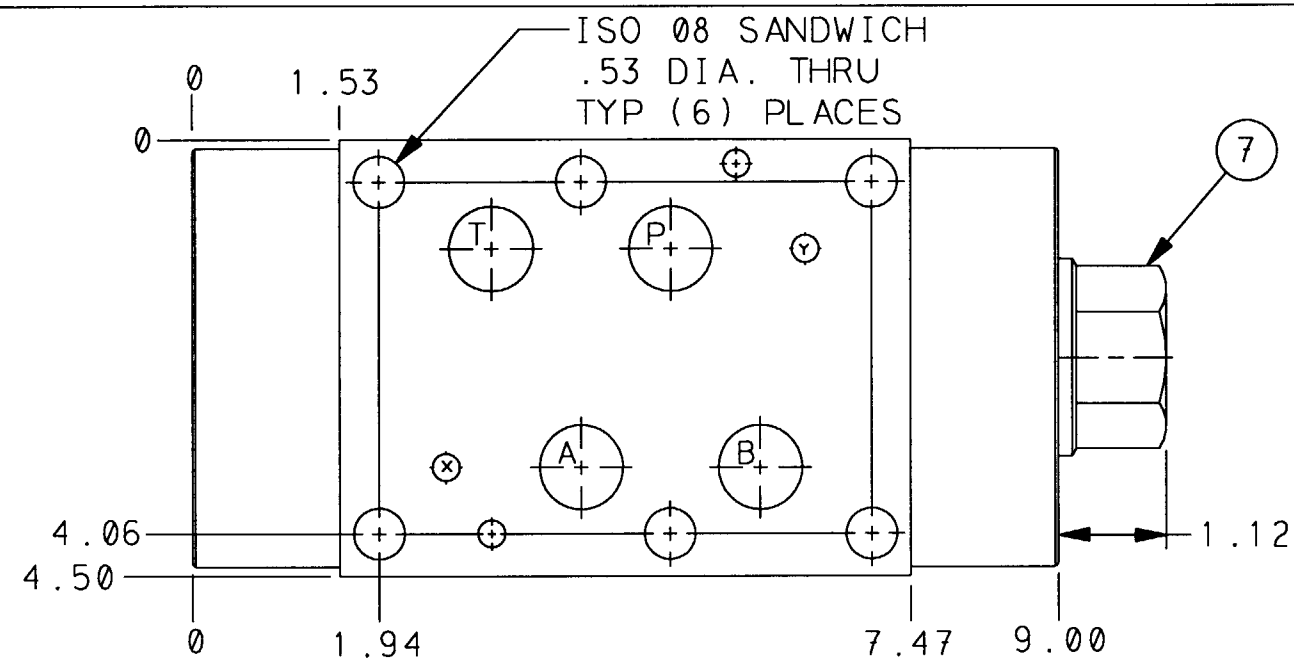


7	CXJA XCN	CHECK VALVE	1
6	811-001-002	ROLL PIN	1
5	330-006-008	PLUG	1
4	500-002-908	"O"RING	1
3	500-001-121	"O"RING	4
2	500-001-114	"O"RING	2
1	153-845	BODY	1
ITEM	PART NO.	PART NAME	QTY

SYMBOL

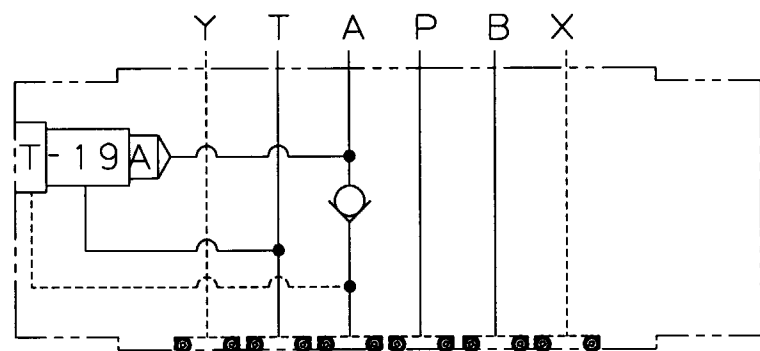

OUTLINE & ASSEMBLY

										UNLESS OTHERWISE SPECIFIED	TITLE ISO 08 SANDWICH-PRIORITY FLOW CONTROL ON "A" w/ REVERSE FREE-FLOW CHECK			REVISION	PART NO. Z3L
										DIMENSION TOL	SCALE REF.	MATERIAL			
										.x = ±.030	1/2	ALUM. & NOTED			
										.xx = ±.015					
										.xxx = ±.005					
										ANGLE TOL ± 1/2					
LET	REVISION				DATE	DRN	CHK	REL	REMOVE ALL BURRS	DRAWN DAS	CHECK DAS	RELEASE 7111	HEAT TREAT & FINISH 	 sun hydraulics [®] CORPORATION 1500 WEST UNIVERSITY PKWY SARASOTA, FLORIDA 34243, USA TELEPHONE (941) 362-1200	
									DATE 27FEB96	DATE 27FEB96	DATE 13MAR96				