


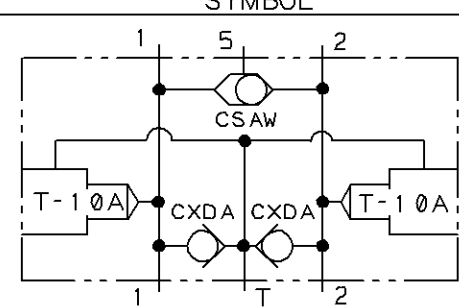
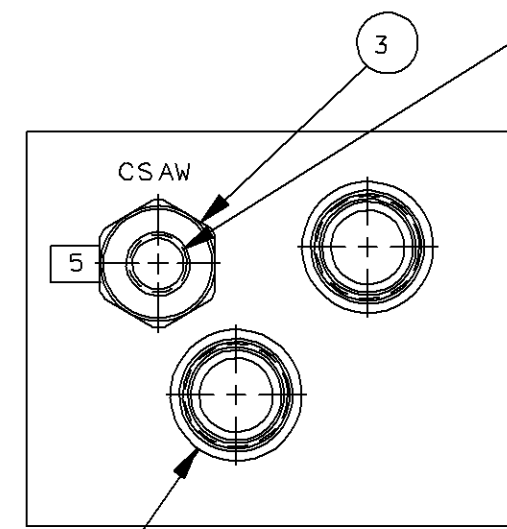
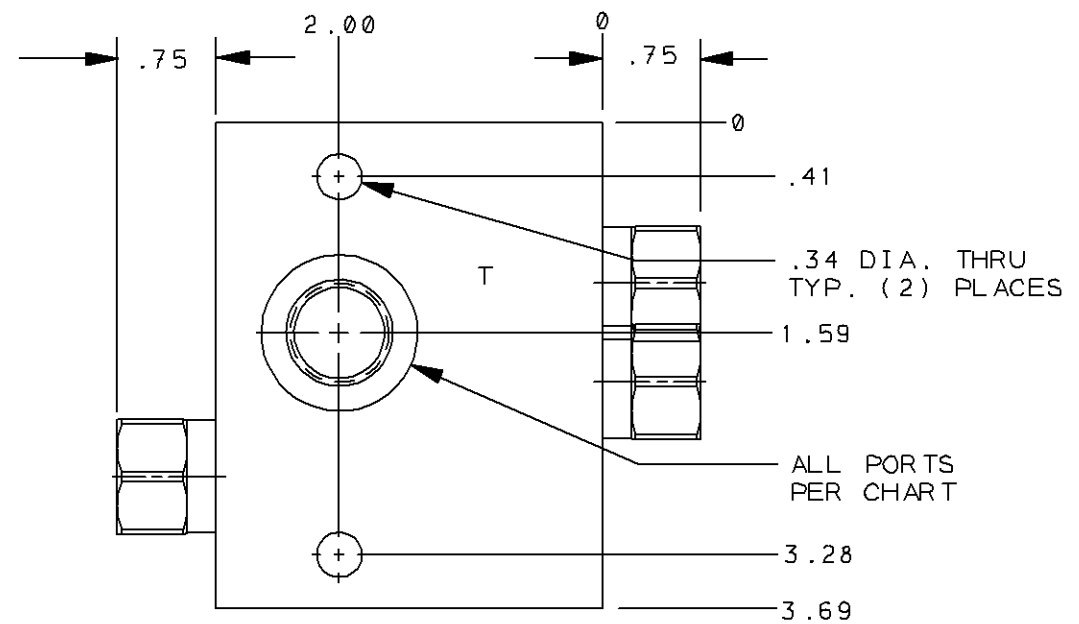


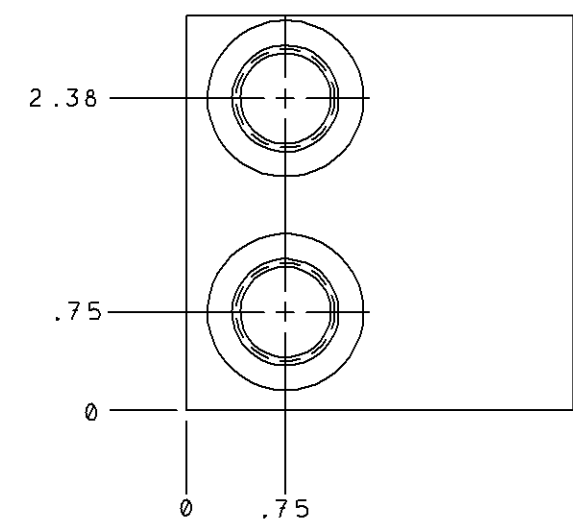

STD SAE -4 PORT
BODY DASH NO. -001 THRU -006
STD BSPP -4 PORT
BODY DASH NO. -007 THRU -009

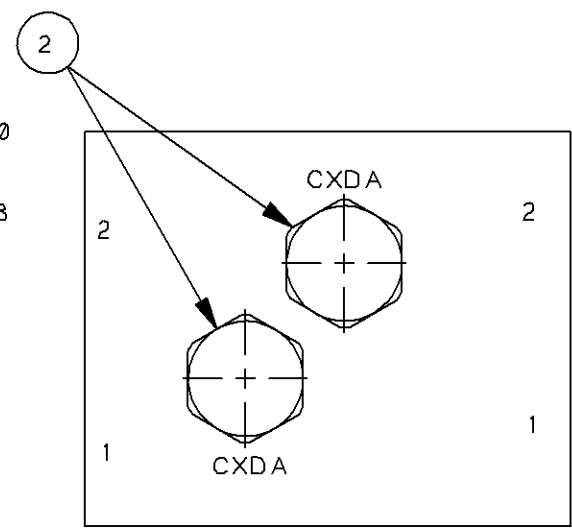

T-10A CAVITY W/
.031 L. S. DEPTH
TYP. (2) PLACES

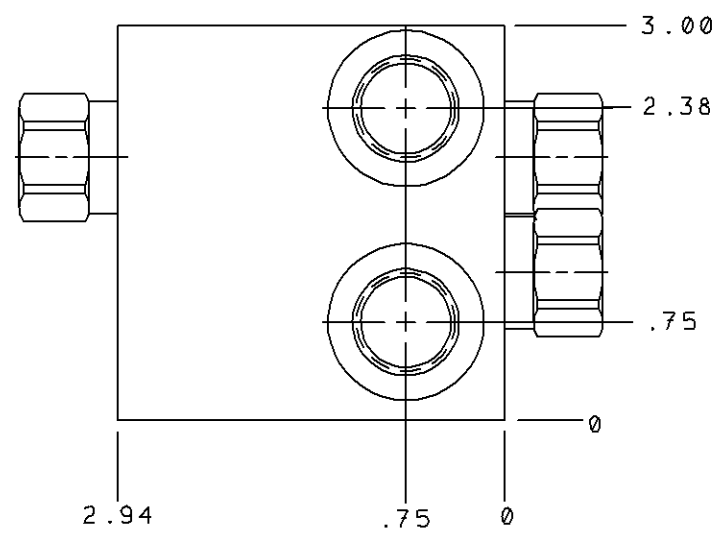

- NOTES:
- 1) SEALS: BUNA N
 - 2) BODY: ALUMINUM
 - 3) CXDA XAN CARTRIDGE:
CRACK PRESSURE: 4 PSI +/- 1
CHECK SEAT: STEEL
 - 4) FOR OTHER OPTIONS-
SEE OPTION SHEET

CHART A (PORT OPTIONS)		
MODEL NUMBER	ALL PORTS	BODY DASH NO. ITEM 1
FHA	.250-18 NPTF	-001
FHB	.375-18 NPTF	-002
FHC	.500-14 NPTF	-003
FHD	SAE -6	-004
FHE	SAE -8	-005
FHF	SAE -10	-006
FHG	.250-19 BSPP	-007
FHH	.375-19 BSPP	-008
FHI	.500-14 BSPP	-009

3	CSAW **	SHUTTLE CART.	1
2	CXDA XAN	CHECK CART.	2
1	154-362 SEE TABLE	BODY	1
ITEM	PART NO.	PART NAME	QTY

OUTLINE & ASSEMBLY				TITLE T-10A CROSSPORT RELIEF W/ ANTICAV CHECKS & SHUTTLE				REVISION PART NO. B FH*			
UNLESS OTHERWISE SPECIFIED				SCALE REF				MATERIAL			
DIMENSION TOL				FULL				ALUMINUM & STEEL			
.X = +/- .030				DRAWN				CHECK DSS			
.XX = +/- .015				DATE				RELEASE 9203			
.XXX = +/- .005				DATE				DATE			
ANGLE TOL +/- 1				DATE				DATE			
FINISH 40 V				DATE				DATE			
REMOVE ALL BURRS				DATE				DATE			
B CK VALVE SYM. WERE REVERSED				16OCT00 MW B DSS 0072							
A ADDED SUN LOGO AND FH* STAMPING				26JUL04 DSS DEB 9924							
LTR				REVISION							

SUN hydraulics CORPORATION
701 TALLEY ROAD
SARASOTA, FLORIDA 34243, USA
TELEPHONE (941) 362-1300